

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

Process Sheet

Ship June 14<sup>th</sup>

24

Customer : CU-DAR001 Dart Helicopters Services  
Job Number : 32708A  
Estimate Number : 10803  
P.O. Number :  
This Issue : 5/29/2007 S.O. No. :  
Prsht Rev. : NC  
First Issue : 1 / Type : LANDING GEAR  
Previous Run : 32707A  
Drawing Name : FLOAT SKIDTUBE HIGH GEAR 206 A/B  
Part Number : D206642641  
Drawing Number : D3288 REV C  
Project Number : N/A  
Drawing Revision : C  
Material :  
Due Date : 6/15/2007 Qty: 1 Um: Each  
Written By :  
Checked & Approved By : 07.05.29  
Comment : Est Rev:B 05.11.15 Added washers for aft cap, wearshoes and ring EC  
Est Rev:C 06-05-31 Revised steps JLM  
Est Rev:D 07-02-22 Added SS Wearplates & Gaskets JLM

Additional Product

Job Number:



Seq. # Machine Or Operation: Description:

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-641 CHG002

2.0

D2620

Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 3" OD Bent Tube B31482 DP 7-5-31

3.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647 Fwd Cap B29328 BE 07-05-31

4.0

D32861

Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler B29090 Pm 07-06-05 C

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr FWD edge of tube, grind bending marks.

2-Remove ridge on inside of fwd edge of tube as per Dwg D3288.

3-Weld Fwd Cap as per Dwg D3288, Grind to obtain proper fit

A/R AL ROD

Batch:

M102421/M103794 BE 07-5-31

4-Grind welds flush to cap on top surface only.

BE 07-05-31

5-Cut Aft end as per Dwg D3288 from front of tube then deburr

6-Remove inner indexing ridge on aft end as per Dwg d3288

7-Open holes for aft cap as per Dwg D3288 using Dt8025

8-Drill pilot holes using DT8818

9-Insert D3286-1 doubler using DT8732 & DT8879, then locating doubler off the D3286-1 doubler, leave Dt8732 for added support

3/16" holes cleco

10-Drill D3286-1 doubler rivet holes in tube using #40 drill, spot drilling doubler at the same time.

11-Working from center out, drill #30 holes into D3286-1 Doubler. cleco each hole after its drilled, Verify angle of holes to accomodate rivet heads.

12-Remove 3/16" clecos only and open GHW holes to .500" as per Dwg D3288.

13-Remove D3286-1 doubler, identify orientation, deburr then attach to W/O

14-Remove indexing edge as per Dwg D3288.

15-C'sink rivet holes as per Dwg D3288.

Pw 07-06-060

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



*pm 07-06-06*



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BE 07-06-06*

9.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet *m16896*

*pm 07-06-07*

10.0

D3289041

Float Web (206A/B)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3289-041 Float Web *B24364*

*[Handwritten mark]*

11.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Holes to finished size as per DWg D3288. Debur.

*pm 07-06-06*

2-Locate, install and rivet doublers as per Dwg D3288. Micro-shave rivets as required.

*pm 07-06-07*

3-Bond web in place as per Dwg D3288 & QSI 015.

A/R Sikaflex-291

*M103561*

Sikaflex expire date:

*7-10-1*

Start:

*7-6-7*

Time:

*8:40*

Finish:

*7-6-12*

Time:

*9:00am EZ*

(Adhere for 12 hours)

*76-7*

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*BE 07-06-12*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description:

13.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube using program D3288 as per Dwg D3288. Install drop pins in cross bolt spacer holes to maintain web position.

EL 7-6-12

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes for wearplates using D3288-T2 as per Dwg D3288, then open to  $\varnothing 0.297$ ". (without cutting fluid)

DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)

2-C'sink X-bolt holes

3-Debur

fm 07-06-13

fm 07-06-13

fm 07-06-13

fm 07-06-13

15.0

D2649

Crossbolt Spacer



Comment: Qty.: 9.0000 Each(s)/Unit Total: 9.0000 Each(s)

Pick:

Qty Part Number Description Batch

9 D2649 Crossbolt spacer

B 31926 BE 07-06-13

16.0

D32751

Crossbolt Spacer



Comment: Qty.: 9.0000 Each(s)/Unit Total: 9.0000 Each(s)

Pick:

Qty Part Number Description Batch

9 D3275-1 Crossbolt spacer

B 29567 BE 07-06-13

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-3

Spacer

B 32515 BE 07-06-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3288. Remember to back drill each hole before welding the other side. Use aluminum rod.

A/R Aluminum Rod *M-102421 BE 07-06-13*

2-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D3288. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required

A/RSS Rod *NONE BE 07-06-26*

3-Grind welds flush to Fwd cap on top surface only. *BE 07-05-31*

4-Grind cross bolt welds flush as per Dwg D3288. Masking Tape access to inside of the skidtube *Pm 07-06-14*

5-Counterbore 5/16" x 0.750" deep using DT8747, except 8th cross bolt hole from Aft end, as per Dwg D3288. *Pm 07-06-27*

19.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

*07/07/04*

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*En 07/07/04 (X1)*

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

22.0

POWDER COATING

POWDER COATING



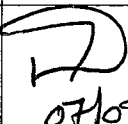
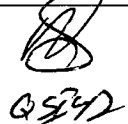
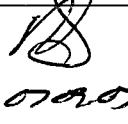


Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: See NCR 203 NCR: Yes ☒ No ☐ DQA: D Date: 07/09/10  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

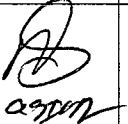NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07-09-07	70	See NCR 203 Used Ser testing destroyed in process		Give to Eng.	 07-09-07	 07/09/10	 05/24/10	 07/09/10

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

24.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3415-041 Nut Plate \_\_\_\_\_

25.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivet \_\_\_\_\_

26.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CR3212-4-03 Rivet \_\_\_\_\_

27.0

ALS71032130

Insert



Comment: Qty.: 64.0000 Each(s)/Unit Total : 64.0000 Each(s)

Insert

Batch: \_\_\_\_\_

28.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D3415-041 Nut Plate as per Dwg D3288 ,Install with LPS-3

A/R LPS-3 Batch: \_\_\_\_\_

2-Install inserts Dwg D3288. Use a drop of Sikaflex inside insert holes

A/R Sikaflex-291 \_\_\_\_\_

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: \_\_\_\_\_

29.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inserts & Nut plate

30.0

D353515

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: \_\_\_\_\_

31.0

D353521

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: \_\_\_\_\_

32.0

D353535

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: \_\_\_\_\_

33.0

D353541

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: \_\_\_\_\_

34.0

D353615

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: \_\_\_\_\_

35.0

D353621

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

36.0	D353635	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
GASKET  
Batch: \_\_\_\_\_

37.0	D353641	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
GASKET  
Batch: \_\_\_\_\_

38.0	D35371	WEARPAD
------	--------	---------



Comment: Qty.: 7.0000 Each(s)/Unit Total : 7.0000 Each(s)  
WEARPAD  
Batch: \_\_\_\_\_

39.0	D35373	WEARPAD
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEARPAD  
Batch: \_\_\_\_\_

40.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 66.0000 Each(s)/Unit Total : 66.0000 Each(s)  
BOLT  
Batch: \_\_\_\_\_

41.0	NAS1515H3L	WASHER
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
2 NAS1515H3L Washer \_\_\_\_\_

42.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 64.0000 Each(s)/Unit Total : 64.0000 Each(s)  
Pick:  
Qty Part Number Description Batch

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

64 AN960C10L Washer

43.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring

44.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt

45.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960JD416 Washer

46.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap

47.0

AN960C10L

washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960C10L Washer

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 5/29/2007 9:59:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE HIGH GEAR 206 A/B

Job Number: 32708A

Part Number: D206642641

Job Number:



Seq. #:

Machine Or Operation:

Description :

48.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearshoes/wearpads & Gaskets as per Dwg D3288.

3-Install Ring on Nut Plate as per detail F & Dwg D3288.

4-Spray inside tube with LPS-3 on both sides of web

5-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive.

A/R Sikaflex-291 \_\_\_\_\_

Sikaflex expire date: \_\_\_\_\_

6-Coat all exposed fastners with LPS Procyon,remove any exess on powder coat  
with MEK Degreasser.

A/R LPS Procyon Batch:\_\_\_\_\_

49.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

50.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-641

Location:\_\_\_\_\_

PPP Rev:\_\_\_\_\_

51.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



W 07-09-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN <b>CP</b>	DRAWN BY <b>PH</b>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <b>H</b>	APPROVED <b>H</b>	DRAWING NO. <b>D3288</b>	REV. C SHEET 1 OF 3
DATE <b>06.12.19</b>		TITLE <b>SKIDTUBE ASSEMBLY</b> SCALE <b>NTS</b>	
<b>A</b>	<b>04.05.17</b>	<b>NEW ISSUE</b>	
<b>B</b>	<b>05.03.16</b>	<b>CHANGE INSERTS</b>	
<b>C</b>	<b>06.12.19</b>	<b>NEW INSERTS, SS WEARSHOE + GASKET</b>	

**RELEASED**07.02.12 **H**

Qty -041	Part Number	Description
X	D3288-041	SKIDTUBE ASSEMBLY
1	D2600-1-240	EXTRUSION
1	D2647	CAP
1	D2646	AFT CAP
9	D2649	CROSS BOLT SPACER
9	D3275-1	CROSS BOLT SPACER
2	D3286-1	DOUBLER
2	D3286-3	SPACER
1	D3289-041	FLOAT WEB
1	D3413-1	RING
1	D3415-041	NUT PLATE
1	D3535-15	WEARSHOE
1	D3535-21	WEARSHOE
1	D3535-35	WEARSHOE
1	D3535-41	WEARSHOE
1	D3536-15	GASKET
1	D3536-21	GASKET
1	D3536-35	GASKET
1	D3536-41	GASKET
7	D3537-1	WEARPAD
1	D3537-3	WEARPAD
64	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
66	AN3C4A	BOLT
1	AN4C5A	BOLT
1	AN960C416	WASHER
66	AN960C10L	WASHER
2	CCR264SS3-3	RIVET
2	CR3212-4-03	RIVET
52	CR3212-4-04	RIVET
2	NAS1515H3L	WASHER

**GENERAL NOTES:**


1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3289-041 FLOAT WEB INTO D3288-1 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH:
  - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
  - POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3288-1T2 BEFORE FINISH. INSTALL 130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCOYON". AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 32708A


**Copyright © 2004 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.




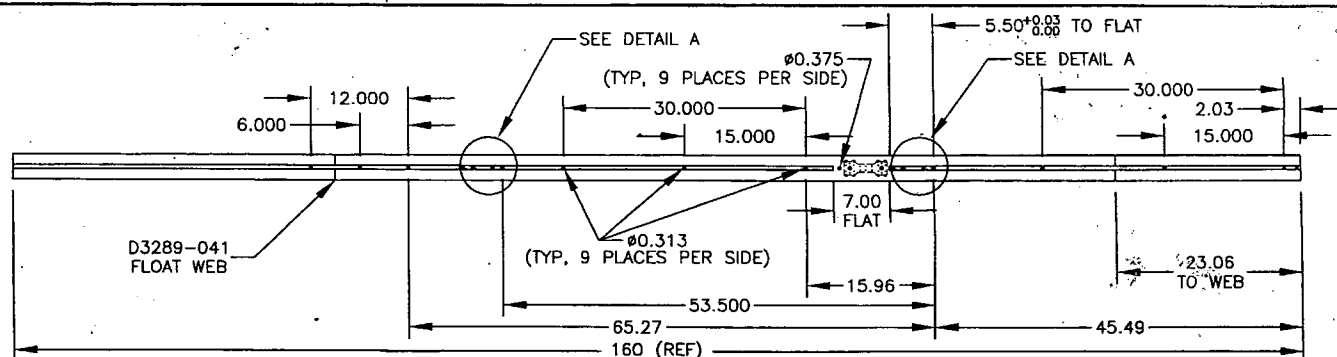

**D3288-041 DRILLING/ASSEMBLY DETAIL**

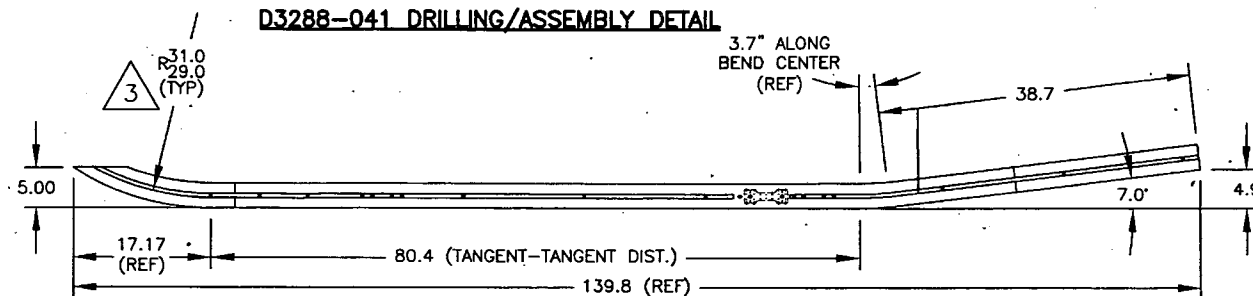

**D3288-041 BEND/DRILLING DETAIL**

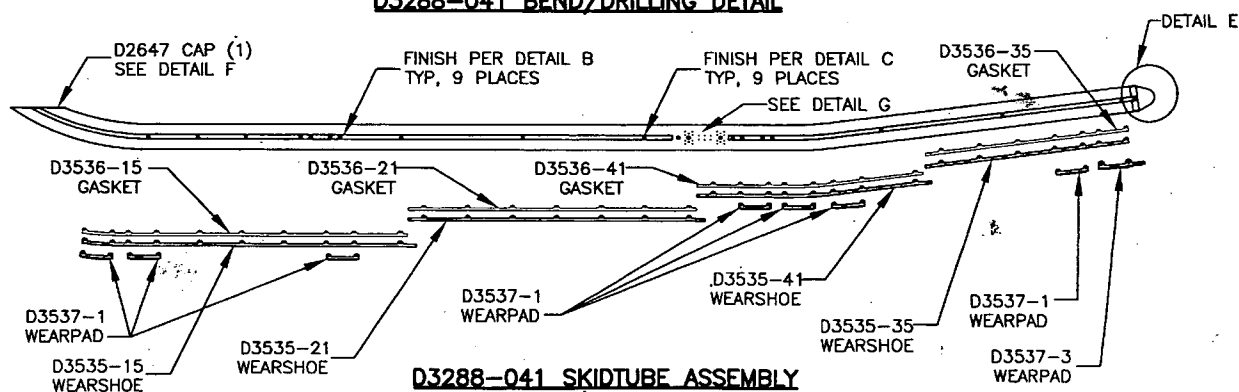


**D3288-041 SKIDTUBE ASSEMBLY**


NO. 32708A  
 WORK ORDER  
 WITHOUT NOTICE  
 UNCONTROLLED COPY  
 SUBJECT TO AMENDMENT  
 ENGINEERING  
 RETURN TO  
 DART AEROSPACE  
 PORT HADLOCK, OH  
 BASED

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, OH
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CP	PH	
CHECKED	DATE	APPROVED	DRAWING NO.	REV. C
#	06.12.19	#	D3288	SHEET 2 OF 3
TITLE			SCALE	
SKIDTUBE ASSEMBLY			1:15	

# **DETAIL A: DRILL DETAIL**

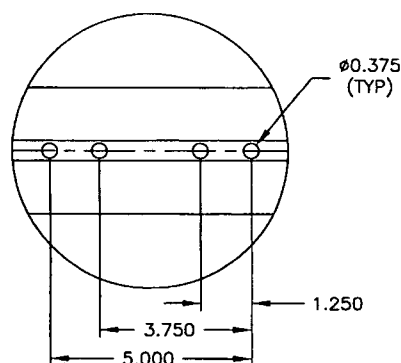


# **DETAIL B** FOR 0.375 HOLES ONLY

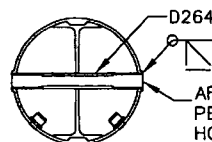

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR 0.375  
HOLES ONLY:  
1. CHAMFER HOLE 0.030x45°  
2. INSERT D2649 SPACER  
3. WELD INTO PLACE AND GRIND FLUSH  
4. C'BORE TO 0.313x0.75 DEEP


# **DETAIL C** FOR 0.313 HOLES ONLY

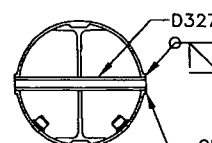


CHAMFER  
0.030x45°  
(TYP)

# **DETAIL G** SCALE 1:5

DRILL #30  
C'SINK 0.229x100°  
INSTALL CR3212-4-04  
RIVET (26 PER DOUBLER)

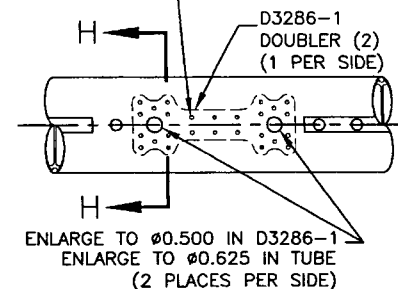


# **SECTION H-H** NOT TO SCALE

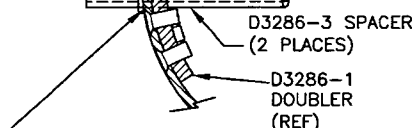

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
  2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
  3. ENLARGE HOLES IN D3286-1 TO 0.500
  4. ENLARGE HOLES IN TUBE TO 0.625
  5. RIVET D3286-1 TO TUBE
  6. INSERT D3286-3 SPACER
  7. WELD IN PLACE AND GRIND FLUSH


# **DETAIL D**

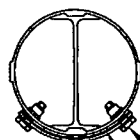


ALS7-1032-130 INSERT (1)  
AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
(64 PLACES)

GASKET/WEARSHOE/WEARPAD (REF)

 RELEASED



# **DETAIL E**

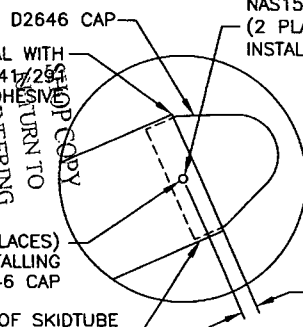

AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(2 PLACES)  
INSTALL WITH SIKAFLEX-241/-291

AN4C5A BOLT (1)  
AN960C416 WASHER (1)  
INSTALL WITH SIKAFLEX-241/-291

D3413-1 RING

1.0  
REMOVE RIDGE  
ON INSIDE OF  
SKIDTUBE LEAVE  
0.070 MIN.

ORIENTATION  
OF D3415-041

CCR264SS3-3 RIVETS (2 PLACES)  
INSTALL WITH LPS-3

CR3212-4-03 RIVETS (2 PLACES)  
INSTALL WITH LPS-3

D3415-041 NUT PLATE,  
LPS-3 ON FAYING SURFACE,  
LPS HARDCOAT ON EXTERIOR

D2647 CAP (REF)

1/16

# **DETAIL F NOTES**

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D3415-041  
PRIOR TO FINISH

NO. 2108A  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
UNCONTROLLED COPY  
SEAL WITH  
D3415-291  
ADHERING  
TOP COPY  
TURN TO  
RETURN TO  
D2646 CAP  
0.0208 (2 PLACES)  
DRILL PRIOR TO INSTALLING  
D2646 CAP

BORE OUT END OF SKIDTUBE  
TO 0.75 DEPTH AND 0.070 WALL

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, VA
CHECKED	#	APPROVED	#	DRAWING NO. D3288
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. C SHEET 3 OF 3 SCALE 1:3





NO. 114

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay Elliot  
Joint Welding Procedure TIG  
Part number and Job number BAC6642541/B3297

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS TIG  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 01-06-20 Qualifier Pat Duval

